Order guide

G | LJ | E - C1 | D - Z | K8 - 2K - Q2 - R2 - S2 - P35

Major category: G | Series: LJ | Category: E | 1 Material: C1 | 2 ST: D | 3 Hole distance selection: Z | 4 WxH: K8 | 5 Side holes: 2K | 6 Thread: Q2 | 7 Thread: R2 | 8 Thread: S2 | 9 Spacing: P35

Please refer to the series code to select the type and parameters for ordering.

Code	Endface processing	Shape	Hole spacing selection 3	WxH 4	Material 1	ST 2	Atmospheric pressure
GLJE-C1D-GK3					SS400	Galvanized	<20.6MPa(210Kgf/cm²)
GLJE-C1N1-GK3				40x40		Electroless nickel plating	
GLJE-S2W-GK3			Fixed pitch		SUS316	No	<1MPa(10.2Kgf/cm²)
GLJE-UW-GK3					H65		
GLJE-C1D-GK8	No hole on side end	T type		50x50			
GLJE-C1D-GK6				60x60			
GLJE-C1D-ZK3				40x40	SS400	Galvanized	<20.6MPa(210Kgf/cm²)
GLJE-C1D-ZK8			Hole pitch specified	50x50			
GLJE-C1D-ZK6				60x60			

Fixed pitch

WxH: 40x40

GLJE-C1D-GK3
GLJE-C1N1-GK3
GLJE-S2W-GK3
GLJE-UW-GK3

Hole pitch specified type

WxH: 40x40

GLJE-C1D-ZK3

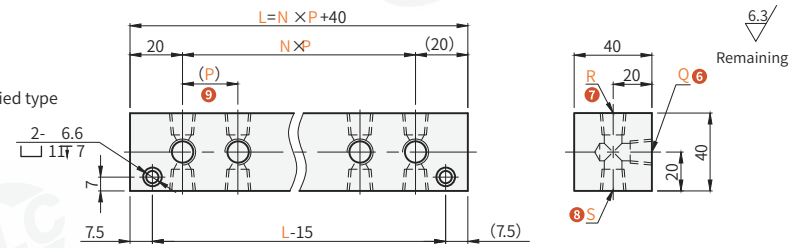

Fixed pitch

WxH: 50X50

GLJE-C1D-GK8

WxH: 60X60

GLJE-C1D-GK6

Hole pitch specified type

WxH: 50X50

GLJE-C1D-ZK8

WxH: 60X60

GLJE-C1D-ZK6

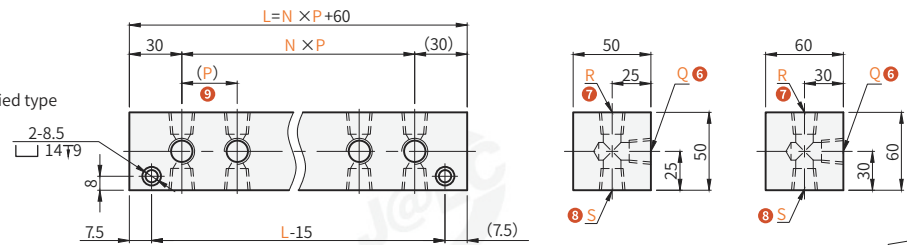

For the type with a specified hole pitch, please specify the P value reasonably to avoid joint interference or insufficient space for disassembly.

Perspective standard: first perspective

Fixed pitch type

Model		PT/NPT selection	Spacing P	N	Number of screw holes
Code	Side holes 5	Q 6 R 7 S 8			
WxH40x40 GLJE-C1D-GK3 GLJE-C1N1-GK3 GLJE-S2W-GK3 GLJE-UW-GK3	1K	1 (1/8)	40	0	3
	2K	2 (1/4)		1	6
	3K	3 (3/8)		2	9
	4K	1N (NPT1/8)		3	12
	5K	2N (NPT1/4)		4	15
	6K	3N (NPT3/8)		5	18

When the number of holes on the side is "6K", a mounting hole for M6 screws is added at the L/2 position.

Fixed pitch type

Model		PT selection	Spacing P	N	Number of screw holes
Code	Side holes 5	Q 6 R 7 S 8			
WxH50x50 GLJE-C1D-GK8 WxH60x60 GLJE-C1D-GK6	1K		60	0	3
	2K	2 (1/4)		1	6
	3K	3 (3/8)		2	9
	4K	4 (1/2)		3	12
	5K	6 (3/4)		4	15
	6K			5	18

When the number of holes on the side is "6K", a mounting hole for M6 screws is added at the L/2 position.

W x H: 30x30 Q-R-S size, tapered holes at right angles cannot be selected at the same time in the direction of 6(3/4).

Hole pitch specified type

Model		PT/NPT selection	Spacing P 9	N	Number of screw holes
Code	Side holes 5	Q 6 R 7 S 8	Min. unit 1		
WxH40x40 GLJE-C1D-ZK3	2K	1 (1/8)		1	6
	3K	2 (1/4)		2	9
	4K	3 (3/8)	25~50	3	12
	5K	1N (NPT1/8) 2N (NPT1/4)		4	15
	6K	3N (NPT3/8)	30~50	5	18

When the number of holes on the side is "6K", a mounting hole for M6 screws is added at the L/2 position.

Hole pitch specified type

Model		PT selection	Spacing P 9	N	Number of screw holes
Code	Side holes 5	Q 6 R 7 S 8	Min. unit 1		
WxH50x50 GLJE-C1D-ZK8 WxH60x60 GLJE-C1D-ZK6	2K	2 (1/4)		1	6
	3K	3 (3/8)	35~60	2	9
	4K	4 (1/2)		3	12
	5K			4	15
	6K	6 (3/4)	40~60	5	18

When the number of holes on the side is "6K", a mounting hole for M6 screws is added at the L/2 position.

W x H: 30x30 Q-R-S size, tapered holes at right angles cannot be selected at the same time in the direction of 6(3/4).